DM2200 Sleep Duty Cycle Demonstration

by Frank Perkins

The example application shown in Figures 1 and 2 measures temperature using a thermistor-resistor circuit connected to GP6 on a DM2200 field node, on a 15 seconds active, 60 seconds sleep network power management duty cycle. The application is written in Microsoft Visual Basic 6.0 (SP6). The sensor used is a Vishay BCcomponents 2322 640 66103 NTC thermistor, which has a nominal resistance of 10K at 77 °F (25 °C). This thermistor is readily available from Digi-Key and other electronic component distributors. The data sheet for the thermistor was located at [www.vishay.com-docs-29049-23226403.pdf](). The thermistor is connected between the 3 V regulated output on the DM2200 and the ADC input, and a 10K, 1% resistor is connected from the ADC input to ground. The thermistor and the 10K resistor form a voltage divider to drive the ADC input, where the voltage increases with increasing temperature, as shown in Figure 3. Figure 4 shows the thermistor and resistor installed on an IM2200 interface module.

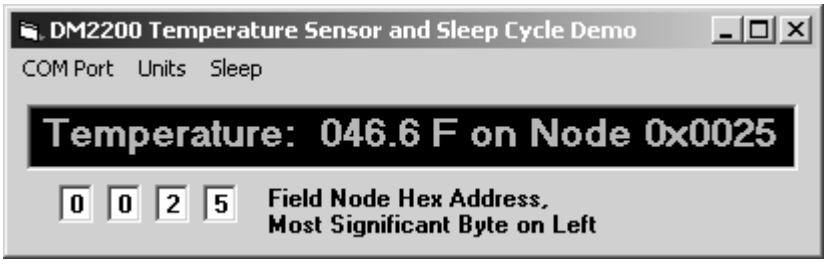


Figure 1: Network Active

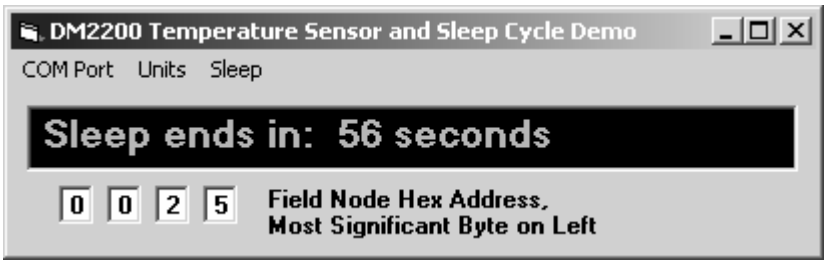


Figure 2: Network Sleeping

The example program is contained in a single Visual Basic form. The heart of the program is *Timer1_Timer*, which is launched once every second by a timer control. This routine first checks the serial port input buffer. If the input buffer is holding one or more bytes, the *GetRX* subroutine is called to collect and process them. *Timer1_Timer* then calls *TXCmd* to output a *CMD_IO IO_ADC* (read ADC), which propagates through the DM2200 network to the addressed field node. The field nodes makes the ADC measurement and sends a response back to be read on the next *Timer1_Timer* cycle.

Each time *GetRX* is called, it collects the newly received bytes in *ComData$* and calls *RXRsp*. The function of *RXRsp* is to extract messages from the stream of received

bytes. *RXRsp* adds *ComData$* to the end of the *FIFO$* string. The *FIFO$* string is then scanned and complete messages are extracted. Any partial message at the end of the FIFO$ string is saved for future processing.

Each time *RXRsp* extracts a complete network message, it calls either *ShowT or CheckC*, depending on the length of the core message. The *ShowT* subroutine filters out all network messages except *CMD_IO IO_ADC* response messages. The ADC measurements are then converted to temperature readings and displayed. The *GetTemp* subroutine does the temperature conversion using the *TmpArry* table values and interpolation. The *TmpArry* table values were derived from a resistance versus temperate table in the BCcomponents data sheet. These resistance values were, in turn, used to compute the *TmpArry* table of output voltage ratios, in terms of ADC counts, for the thermistor-resistor voltage divider.

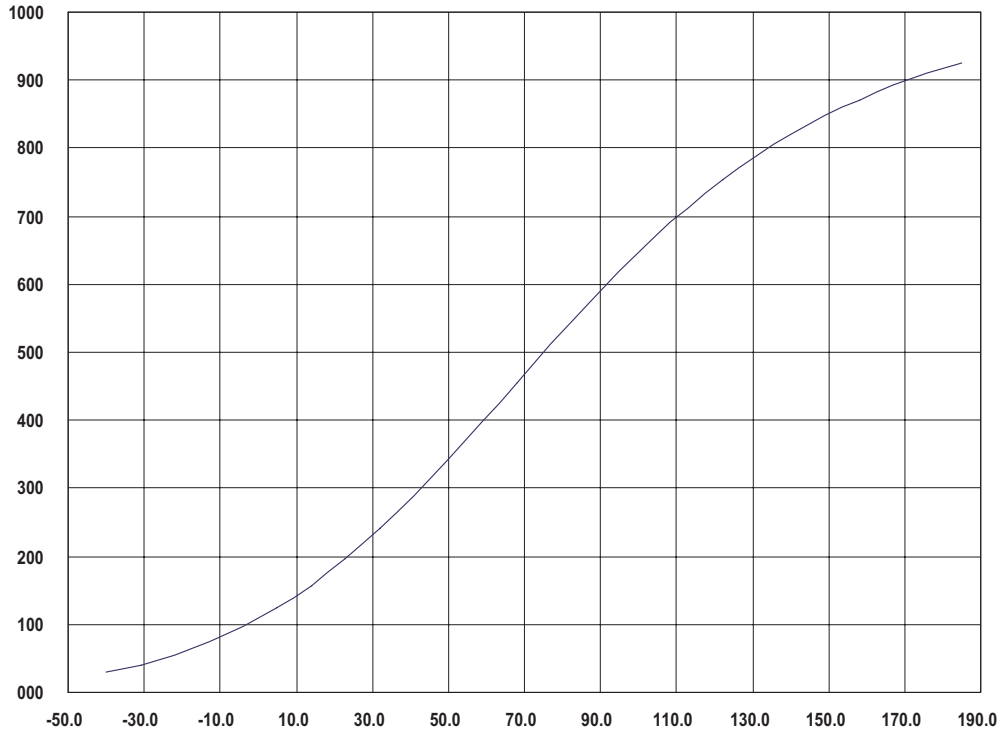


Figure 3: ADC Count$_{10}$ versus Temperature in °F

The *CheckC* subroutine filters out all network messages except the *CMD_GET ATTR_CYC_LEFT* response messages. If the master node is in the rest part of the sleep cycle, the number of seconds left in rest is displayed.

TXCmd builds and sends command messages. When the application is started and a valid COM port is entered, a *CMD_MASTER* (enable master beacon) is immediately sent. Then *TXCmd* sends commands to disable field node sleep, set the field node sleep period to 60 seconds, re-enable field node sleep, disable master node sleep, set the master node sync and rest periods to 15 and 60 seconds respectively, re-enable master node sleep, and set the master beacon interval to 10 seconds. Following these

initialization messages, TXCmd sends *CMD_GET ATTR_CYC_LEFT* messages. If the response to this command indicates the master beacon is in the *sync* state, TXCmd then sends a *CMD_IO IO_ADC* to get an updated ADC reading. Note that the *op_ref* (message ID) byte is changed for every message transmitted to a field node(s). This is required for normal network operation.

The sleep duty cycle example has been kept simple to avoid obscuring the basic DM2200 network command-response program methodology. Nevertheless, this simple program can be used to remotely monitor a temperatures over an outdoor path of more than a mile using the four nodes in the DM2200-916-DK development kit. The duty cycle chosen for this example will increase field node battery life by a factor of more than four over continuous network operation.

An application install package, the project files and a spreadsheet tabulation of the temperature sensor voltage divider can be downloaded from Cirronet's web site at www.cirronet.com., and is also included on the DM2200-916-DK development kit.

After the application is installed, launch it and select the COM port. For PCs with a serial port, this is usually *COM1*. In the case of USB operation, a virtual COM port is assigned to the IM2200 USB port by the associated USB virtual COM port driver. *COM5* is shown in the example in Figure 5. Next enter the address of the field node that has the thermistor-resistor voltage divider installed (*Node 0x0025* is shown in Figure 1). The *Units* menu selects Fahrenheit or Celsius for the temperature display.

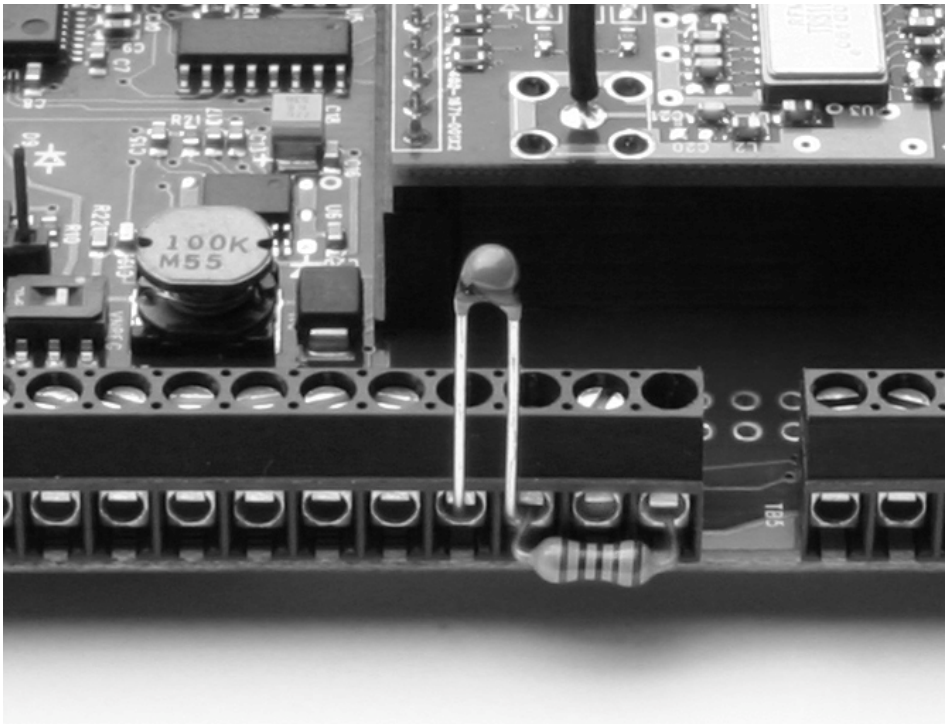


Figure 4: IM2200 Thermistor-Resistor Installation

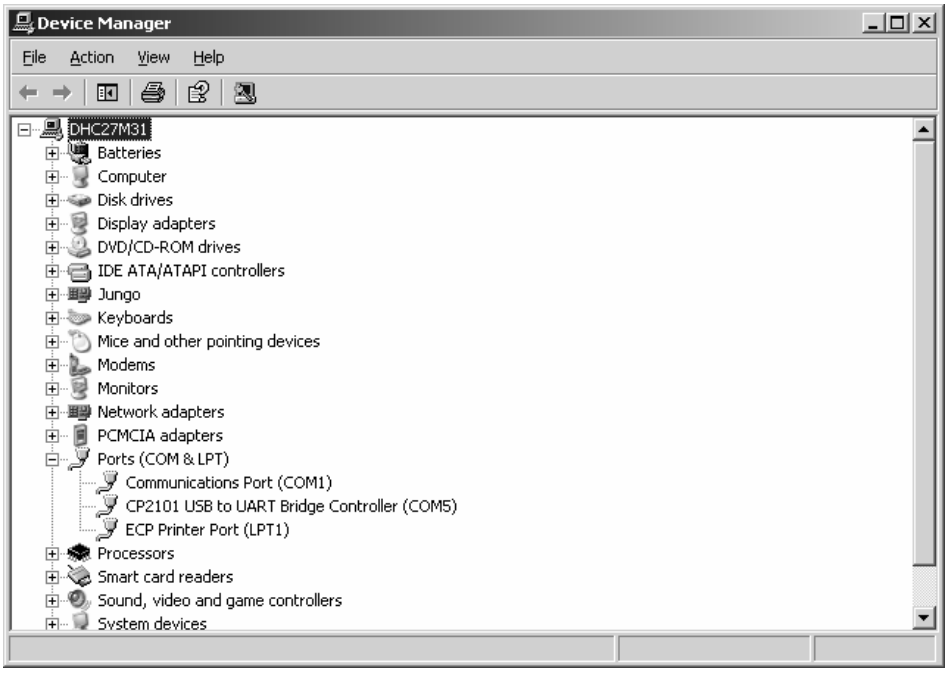


Figure 5: COM Port Verification

DM2200 Sleep Cycle Demonstration Source Code

```
VERSION 5.00
Object = "{648A5603-2C6E-101B-82B6-000000000014}#1.1#0"; "MSCOMM32.OCX"
Begin VB.Form Form1
   Caption         =   "DM2200 Temperature Sensor and Sleep Cycle Demo"
   ClientHeight    =   1215
   ClientLeft      =   165
   ClientTop       =   735
   ClientWidth     =   6030
   ForeColor       =   &H00000000&
   LinkTopic       =   "Form1"
   ScaleHeight     =   1215
   ScaleWidth      =   6030
   StartUpPosition =   3  'Windows Default
   Begin VB.TextBox Text4
      Alignment       =   2  'Center
      BeginProperty Font
         Name            =   "MS Sans Serif"
         Size            =   8.25
         Charset         =   0
         Weight          =   700
         Underline       =   0   'False
         Italic          =   0   'False
         Strikethrough   =   0   'False
      EndProperty
      Height          =   285
      Left            =   1440
      TabIndex        =   5
      Text            =   "0"
      Top             =   720
      Width           =   255
   End
   Begin VB.TextBox Text3
      Alignment       =   2  'Center
      BeginProperty Font
         Name            =   "MS Sans Serif"
         Size            =   8.25
         Charset         =   0
         Weight          =   700
         Underline       =   0   'False
         Italic          =   0   'False
         Strikethrough   =   0   'False
      EndProperty
      Height          =   285
      Left            =   1080
      TabIndex        =   4
      Text            =   "0"
      Top             =   720
      Width           =   255
   End
   Begin VB.TextBox Text2
      Alignment       =   2  'Center
      BeginProperty Font
         Name            =   "MS Sans Serif"
         Size            =   8.25
         Charset         =   0
         Weight          =   700
         Underline       =   0   'False
         Italic          =   0   'False
         Strikethrough   =   0   'False
      EndProperty
      Height          =   285
      Left            =   720
      TabIndex        =   3
      Text            =   "0"
      Top             =   720
```

```
      Width           =   255
   End
Begin VB.TextBox Text1
      Alignment       =   2  'Center
      BeginProperty Font
         Name            =   "MS Sans Serif"
         Size            =   8.25
         Charset         =   0
         Weight          =   700
         Underline       =   0   'False
         Italic          =   0   'False
         Strikethrough   =   0   'False
      EndProperty
      Height          =   285
      Left            =   360
      TabIndex        =   2
      Text            =   "0"
      Top             =   720
      Width           =   255
   End
   Begin MSCommLib.MSComm MSComm1
      Left            =   4560
      Top             =   120
      _ExtentX        =   1005
      _ExtentY        =   1005
      _Version        =   393216
      DTREnable       =   -1  'True
      BaudRate        =   19200
   End
   Begin VB.Timer Timer1
      Enabled         =   0   'False
      Interval        =   1000
      Left            =   4080
      Top             =   120
   End
   Begin VB.Label Label2
      Caption         =   "Field Node Hex Address, Most Significant Byte on Left"
      BeginProperty Font
         Name            =   "MS Sans Serif"
         Size            =   8.25
         Charset         =   0
         Weight          =   700
         Underline       =   0   'False
         Italic          =   0   'False
         Strikethrough   =   0   'False
      EndProperty
      Height          =   495
      Left            =   1920
      TabIndex        =   1
      Top             =   720
      Width           =   2535
   End
   Begin VB.Label Label1
      BackColor       =   &H00000000&
      BorderStyle     =   1  'Fixed Single
      Caption         =   " Select COM Port"
      BeginProperty Font
         Name            =   "MS Sans Serif"
         Size            =   13.5
         Charset         =   0
         Weight          =   700
         Underline       =   0   'False
         Italic          =   0   'False
         Strikethrough   =   0   'False
      EndProperty
      ForeColor       =   &H0000FF00&
      Height          =   495
      Left            =   120
      TabIndex        =   0
```

```
      Top             =   120
      Width           =   5775
   End
Begin VB.Menu mnuSerial
      Caption         =   "COM Port"
      Begin VB.Menu mnuCOM1
         Caption         =   "COM 1"
      End
      Begin VB.Menu mnuCOM2
         Caption         =   "COM 2"
      End
      Begin VB.Menu mnuCOM3
         Caption         =   "COM 3"
      End
      Begin VB.Menu mnuCOM4
         Caption         =   "COM 4"
      End
      Begin VB.Menu mnuCOM5
         Caption         =   "COM 5"
      End
      Begin VB.Menu mnuCOM6
         Caption         =   "COM 6"
      End
      Begin VB.Menu mnuCOM7
         Caption         =   "COM 7"
      End
      Begin VB.Menu mnuCOM8
         Caption         =   "COM 8"
      End
   End
   Begin VB.Menu mnuUnits
      Caption         =   "Units"
      Begin VB.Menu mnuF
         Caption         =   "Deg F"
         Checked         =   -1  'True
      End
      Begin VB.Menu mnuC
         Caption         =   "Deg C"
      End
   End
   Begin VB.Menu mnuSleep
      Caption         =   "Sleep"
   End
End

Attribute VB_Name = "Form1"
Attribute VB_GlobalNameSpace = False
Attribute VB_Creatable = False
Attribute VB_PredeclaredId = True
Attribute VB_Exposed = False

' DM2200DC_10.FRM, 2007.07.25 @ 11:50 CDT
' DM2200 tutorial software
' Thermistor temperature sensor demo
'   with power duty cycle
' NO representation is made that this
' software is suitable for any purpose
' Compiled in Microsoft Visual Basic 6.0

' declare global variables and constants:
  Dim ComData$                                          ' COM input string
  Dim FIFO$                                             ' RX character FIFO
  Dim RPkt$                                             ' response message
  Dim BOT$                                              ' message start character
  Dim EOT$                                              ' message end character
  Dim MSG$                                              ' read ADC on GP6 6 of node 2
  Dim MST$                                              ' master node beacon ON command
  Dim ADC As Single                                     ' get ADC count command
  Dim TmpArry(32, 2) As Single                          ' temperature conversion array
  Dim TempFF As Variant                                 ' formatted temperature, F
  Dim TempCF As Variant                                 ' formatted temperature, C
```

```
  Dim P As Integer                                    ' COM port
  Dim T As Integer                                    ' temperature F or C select flag
  Dim NN$                                             ' node ID string
  Dim ID As Long                                      ' numeric node ID
  Dim OP As Integer                                   ' op_ref (packet ID)
  Dim HT As Integer                                   ' high TX address byte
  Dim LT As Integer                                   ' low TX address byte
  Dim A0 As Long                                      ' address nibble 0
  Dim A1 As Long                                      ' address nibble 1
  Dim A2 As Long                                      ' address nibble 2
  Dim A3 As Long                                      ' address nibble 3
  Dim FND$                                            ' field node sleep disable command
  Dim FNS$                                            ' field node sleep period command
  Dim FNE$                                            ' field node sleep enable command
  Dim MND$                                            ' master node sleep disable command
  Dim MNS$                                            ' master node sync period command
  Dim MNR$                                            ' master node rest period command
  Dim MNE$                                            ' master node sleep enable command
  Dim MNB$                                            ' master node beacon interval command
  Dim MNC$                                            ' get master node cycle command
  Dim S As Integer                                    ' TX message state variable

Private Sub Form_Load()
' initialize global variables and constants:
  ComData$ = ""                                       ' clear COM input string
  FIFO$ = ""                                          ' clear FIFO string
  RPkt$ = ""                                          ' clear response string
  BOT$ = Chr$(&H0)                                    ' message start character
  EOT$ = Chr$(&H4)                                    ' message end character
  Call LoadMsg                                        ' load command messages
  ADC = 0                                             ' clear ADC
  Call LoadArray                                      ' load temperature conversion array
  TempFF = 0                                          ' clear TempFF
  TempCF = 0                                          ' clear TempCF
  P = 1                                               ' default COM port number
  T = 0                                               ' set display default as deg F
  NN$ = ""                                            ' clear node ID string
  ID = 0                                              ' clear node ID value
  OP = 0                                              ' clear op_ref value
  HT = 0                                              ' clear TX high address byte
  LT = 0                                              ' clear TX low address byte
  A0 = 0                                              ' clear address nibble 0
  A1 = 0                                              ' clear address nibble 1
  A2 = 0                                              ' clear address nibble 2
  A3 = 0                                              ' clear address nibble 3
  S = 1                                               ' set TX state to 1
  Form1.Left = (Screen.Width - Form1.Width) / 1.2     ' put form at
  Form1.Top = (Screen.Height - Form1.Height) / 5      '   upper right
  Timer1.Interval = 1000                              ' set timer interval to 1 s
  Timer1.Enabled = False                              ' start timer when COM port selected
End Sub

Private Sub Timer1_Timer()
  If MSComm1.InBufferCount > 0 Then                   ' if bytes in COM input buffer
    Call GetRX                                        '   call to get RX bytes
  End If
  Call TXCmd                                          ' call to send TX command
End Sub

Public Sub TXCmd()
  If (S = 1) Then                                     ' if TX state 1
    OP = OP + 1                                       '   increment op_ref
    If (OP = 9) Then                                  '   if op_ref is 9
      OP = 1                                          '     reset op_ref to 1
    End If
    Mid(FND$, 4, 3) = Chr$(OP) + Chr$(LT) + Chr$(HT)  '   update op_ref and address
    MSComm1.Output = FND$                             '   disable field node sleep cycle
    S = S + 1                                         '   increment state
```

```
  ElseIf (S = 2) Then                                   ' if TX state 2
    OP = OP + 1                                         '   increment op_ref
    If (OP = 9) Then                                    '   if op_ref is 9
      OP = 1                                            '     reset op_ref to 1
    End If
Mid(FNS$, 4, 3) = Chr$(OP) + Chr$(LT) + Chr$(HT)       '   update op_ref and address
    MSComm1.Output = FNS$                               '   set sleep period to 60 s
    S = S + 1                                           '   increment state
  ElseIf (S = 3) Then                                   ' if TX state 3
    OP = OP + 1                                         '   increment op_ref
    If (OP = 9) Then                                    '   if op_ref is 9
      OP = 1                                            '     reset op_ref to 1
    End If
    Mid(FNE$, 4, 3) = Chr$(OP) + Chr$(LT) + Chr$(HT)    '   update op_ref and address
    MSComm1.Output = FNE$                               '   enable field node sleep cycle
    S = S + 1                                           '   increment state
  ElseIf (S = 4) Then                                   ' if TX state 4
    MSComm1.Output = MND$                               '   disable master node sleep cycle
    S = S + 1                                           '   increment state
  ElseIf (S = 5) Then                                   ' if TX state 5
    MSComm1.Output = MNS$                               '   set master sync period to 15 s
    S = S + 1                                           '   increment state
  ElseIf (S = 6) Then                                   ' if TX state 6
    MSComm1.Output = MNR$                               '   set master rest period to 60 s
    S = S + 1                                           '   increment state
  ElseIf (S = 7) Then                                   ' if TX state 7
    MSComm1.Output = MNE$                               '   enable master node sleep cycle
    S = S + 1                                           '   increment state
  ElseIf (S = 8) Then                                   ' if TX state 8
    MSComm1.Output = MNB$                               '   set master beacon period to 7 s
    S = S + 1                                           '   increment state
  ElseIf (S = 9) Then                                   ' if TX state 9
    MSComm1.Output = MNC$                               ' get master sleep cycle state
  ElseIf (S = 10) Then                                  ' if TX state 10 (from CheckC)
    OP = OP + 1                                         '   increment op_ref
    If (OP = 9) Then                                    '   if op_ref is 9
      OP = 1                                            '     reset op_ref to 1
    End If
    Mid(MSG$, 4, 3) = Chr$(OP) + Chr$(LT) + Chr$(HT)    '   update op_ref and address
    MSComm1.Output = MSG$                               '   send command to read ADC
    S = 9                                               '   go back to state 9
  End If
End Sub

Public Sub GetRX()
  On Error Resume Next                                  ' set up error handler
  ComData$ = MSComm1.Input                              ' load ComData$ from COM input buffer
  Call RXRsp                                            ' extract RX response message(s)
End Sub

Public Sub RXRsp()
  Dim I As Integer                                      ' index to next BOT$
  Dim L As Integer                                      ' length byte value
  Dim Q As Integer                                      ' FIFO length
  FIFO$ = FIFO$ & ComData$                              ' add ComData$ to end of FIFO$ string
  ComData$ = ""                                         ' clear ComData$
  RPkt$ = ""                                            ' clear RPkt$
  I = 0                                                 ' clear index
  Q = Len(FIFO$)                                        ' load Q with number in FIFO$
  If (Q > 256) Then                                     ' if FIFO$ is overflowing (garbage)
    FIFO$ = ""                                          '   clear FIFO$
    Exit Sub                                            '   exit
  End If
  If (Q < 6) Then                                       ' if FIFO$ less than 6 characters
    Exit Sub                                            '   exit
  End If
  For Y = 1 To 8                                        ' loop processes up to 8 msgs per call
    Q = Len(FIFO$)                                      ' update FIFO$ length
    I = CInt(InStr(FIFO$, BOT$))                        ' find start of next msg(BOT$)
```

```
    If (I = 0) Then                                         ' if no BOT$ in FIFO$ string
      Exit For                                              '   exit For
    End If
    If (Q > I) Then                                         ' if FIFO$ characters to the right
      FIFO$ = Right$(FIFO$, (Q - I))                        '   remove BOT$ and bytes to the left
      Q = Len(FIFO$)                                        '   update FIFO length
    Else                                                    ' else
      Exit For                                              '   exit For
    End If
    L = Asc(Left$(FIFO$, 1))                                ' get message length up to EOT$
    If (Q >= (L + 2)) Then                                  ' if FIFO$ length >= message length
      If (Mid$(FIFO$, (L + 2), 1) = EOT$) Then              '   if EOT$ properly located
        RPkt$ = Mid$(FIFO$, 2, L)                           '     copy core message
        FIFO$ = Right$(FIFO$, (Q - (L + 2)))                '     delete message from FIFO$
      Else                                                  '   else
        Exit For                                            '     exit For
      End If
    Else                                                    ' else
      Exit For                                              '   exit For
    End If
    If (RPkt$ <> "") Then                                   ' if RPkt$ is not null
      If (Len(RPkt$) = 9) Then                              '   and if the length is 9
        Call ShowT                                          '     call to display temperature
      ElseIf (Len(RPkt$) = 12) Then                         '   else if the length is 12
        Call CheckC                                         '     call cycle check
      End If
      RPkt = ""                                             '   clear RPkt$
    End If
  Next Y
End Sub

Public Sub CheckC()
  Dim CC As Integer                                         ' cycle variable
  Dim TM$                                                   ' time string
  If (Asc(Mid$(RPkt$, 3, 1)) <> &H1) Then                   ' if invalid response
    Exit Sub                                                '   exit
   ElseIf (Asc(Mid$(RPkt$, 1, 1)) <> &H1) Then              ' else if not GET response
    Exit Sub                                                '   exit
  ElseIf (Asc(Mid$(RPkt$, 6, 1)) <> &H22) Then              ' else if not cycle attributes
    Exit Sub                                                '   exit
  End If
  CC = Asc(Mid$(RPkt$, 11, 1))                              ' get cycle state
  If (CC = 2) Then                                          ' if sync state
    S = 10                                                  '   enable ADC read state
  ElseIf (CC = 1) Then                                      ' if rest state
    TM$ = Str(Asc(Mid$(RPkt$, 7, 1)))                       '   get time left in rest state
    Label1.Caption = " Sleep ends in: " + TM$ + " seconds"  '    show time left
  End If
End Sub

Public Sub ShowT()
' filter for valid ADC response
  Dim RH As Integer                                         ' high RX address byte
  Dim RL As Integer                                         ' low RX address byte
  Dim RT As Integer                                         ' 16-bit RX address
  Dim HB As Integer                                         ' high ADC byte
  Dim HL As Integer                                         ' low ADC byte
  Dim VL As Integer                                         ' ADC integer value
  If (Asc(Mid$(RPkt$, 3, 1)) <> &H1) Then                   ' if invalid response
    Exit Sub                                                '   exit
   ElseIf (Asc(Mid$(RPkt$, 1, 1)) <> &HB) Then              ' else if not I/O response
    Exit Sub                                                '   exit
```

```
  ElseIf (Asc(Mid$(RPkt$, 6, 1)) <> &H2) Then             ' else if not ADC response
    Exit Sub                                              '   exit
  End If

' calculate and show new temperature
  RH = Asc(Mid$(RPkt$, 5, 1))                             ' get high address byte
  RL = Asc(Mid$(RPkt$, 4, 1))                             ' get low address byte
  RT = 256 * RH + RL                                      ' calculate 16-bit address
  NN$ = Hex(RT)                                           ' convert address to string
  If (Len(NN$) = 1) Then                                  ' if one hex character
    NN$ = " 0x000" + NN$                                  '   add 0x000 to from
  ElseIf (Len(NN$) = 2) Then                              ' else if two hex characters
    NN$ = " 0x00" + NN$                                   '   add 0x00 to front
  ElseIf (Len(NN$) = 3) Then                              ' else if three hex characters
    NN$ = " 0x0" + NN$                                    '   add 0x0 to front
  Else                                                    ' else
    NN$ = " 0x" + NN$                                     '   add 0x to front
  End If
  HB = Asc(Mid$(RPkt$, 9, 1))                             ' get high ADC byte
  LB = Asc(Mid$(RPkt$, 8, 1))                             ' get low ADC byte
  VL = 256 * HB + LB                                      ' calculate total ADC value
  VL = VL / 4                                             ' scale to 10 bits
  ADC = CSng(VL)                                          ' covert ADC value to single
  Call GetTemp                                            ' convert to temperature
  If (T = 0) Then                                         ' if temperature flag clear
    Label1.Caption = " Temperature:  " + TempFF _
    + " F on Node" + NN$                                  '   show F temperature
  Else                                                    ' else
    Label1.Caption = " Temperature:  " + TempCF _
    + " C on Node" + NN$                                  '   show C temperature
  End If
End Sub

Public Sub GetTemp()
' interpolate from table look-up
  Dim CH As Single                                        ' high ADC interpolation count
  Dim CL As Single                                        ' low ADC interpolation count
  Dim TH As Single                                        ' high temperature interpolation value
  Dim TL As Single                                        ' low temperature interpolation value
  Dim TempF As Single                                     ' raw temperature, F
  Dim TempC As Single                                     ' raw temperature, C
  Dim X As Integer                                        ' loop counter
  For X = 2 To 25
    If (ADC <= TmpArry(X, 1)) Then
      CH = TmpArry(X, 1)
      CL = TmpArry((X - 1), 1)
      TH = TmpArry(X, 2)
      TL = TmpArry((X - 1), 2)
      TempF = TL + (((ADC - CL) * (TH - TL)) / (CH - CL))
      TempFF = Format(TempF, "000.0")
      TempC = (5 / 9) * (TempF - 32)
      TempCF = Format(TempC, "000.0")
      Exit For
    End If
  Next X
  End Sub

Public Sub LoadArray()
' load table look-up array
  TmpArry(1, 1) = 30
  TmpArry(1, 2) = -40
  TmpArry(2, 1) = 41
  TmpArry(2, 2) = -31
  TmpArry(3, 1) = 55
  TmpArry(3, 2) = -22
  TmpArry(4, 1) = 74
  TmpArry(4, 2) = -13
  TmpArry(5, 1) = 96
  TmpArry(5, 2) = -4
  TmpArry(6, 1) = 124
  TmpArry(6, 2) = 5
```

```
  TmpArry(7, 1) = 157
  TmpArry(7, 2) = 14
  TmpArry(8, 1) = 196
  TmpArry(8, 2) = 23
  TmpArry(9, 1) = 241
  TmpArry(9, 2) = 32
  TmpArry(10, 1) = 290
  TmpArry(10, 2) = 41
  TmpArry(11, 1) = 343
  TmpArry(11, 2) = 50
  TmpArry(12, 1) = 398
  TmpArry(12, 2) = 59
  TmpArry(13, 1) = 455
  TmpArry(13, 2) = 68
  TmpArry(14, 1) = 512
  TmpArry(14, 2) = 77
  TmpArry(15, 1) = 567
  TmpArry(15, 2) = 86
  TmpArry(16, 1) = 619
  TmpArry(16, 2) = 95
  TmpArry(17, 1) = 668
  TmpArry(17, 2) = 104
  TmpArry(18, 1) = 712
  TmpArry(18, 2) = 113
  TmpArry(19, 1) = 753
  TmpArry(19, 2) = 122
  TmpArry(20, 1) = 788
  TmpArry(20, 2) = 131
  TmpArry(21, 1) = 820
  TmpArry(21, 2) = 140
  TmpArry(22, 1) = 847
  TmpArry(22, 2) = 149
  TmpArry(23, 1) = 871
  TmpArry(23, 2) = 158
  TmpArry(24, 1) = 892
  TmpArry(24, 2) = 167
  TmpArry(25, 1) = 910
  TmpArry(25, 2) = 176
  TmpArry(26, 1) = 925
  TmpArry(26, 2) = 185
End Sub

Private Sub mnuCOM1_Click()
  P = 1                                          ' COM port 1
  Call SetCOM                                    ' open COM port
  Call ResetCOM                                  ' clear all checkmarks
  mnuCOM1.Checked = True                         ' set this checkmark
End Sub

Private Sub mnuCOM2_Click()
  P = 2                                          ' COM port 2
  Call SetCOM                                    ' open COM port
  Call ResetCOM                                  ' clear all checkmarks
  mnuCOM2.Checked = True                         ' set this checkmark
End Sub

Private Sub mnuCOM3_Click()
  P = 3                                          ' COM port 3
  Call SetCOM                                    ' open COM port
  Call ResetCOM                                  ' clear all checkmarks
  mnuCOM3.Checked = True                         ' set this checkmark
End Sub

Private Sub mnuCOM4_Click()
  P = 4                                          ' COM port 4
  Call SetCOM                                    ' open COM port
  Call ResetCOM                                  ' clear all checkmarks
  mnuCOM4.Checked = True                         ' set this checkmark
End Sub
```

```
Private Sub mnuCOM5_Click()
  P = 5                                                 ' COM port 5
  Call SetCOM                                           ' open COM port
  Call ResetCOM                                         ' clear all checkmarks
  mnuCOM5.Checked = True                                ' set this checkmark
End Sub

Private Sub mnuCOM6_Click()
  P = 6                                                 ' COM port 6
  Call SetCOM                                           ' open COM port
  Call ResetCOM                                         ' clear all checkmarks
  mnuCOM6.Checked = True                                ' set this checkmark
End Sub

Private Sub mnuCOM7_Click()
  P = 7                                                 ' COM port 7
  Call SetCOM                                           ' open COM port
  Call ResetCOM                                         ' clear all checkmarks
  mnuCOM7.Checked = True                                ' set this checkmark
End Sub

Private Sub mnuCOM8_Click()
  P = 8                                                 ' COM port 8
  Call SetCOM                                           ' open COM port
  Call ResetCOM                                         ' clear all checkmarks
  mnuCOM8.Checked = True                                ' set this checkmark
End Sub

Public Sub SetCOM()
  On Error GoTo Skip                                    ' invalid COM port recovery
  If (MSComm1.PortOpen = True) Then                     ' if COM port open
    MSComm1.PortOpen = False                            '   close it
    Timer1.Enabled = False                              '   stop timer
  End If
  MSComm1.CommPort = P                                  ' initialize COM port
  MSComm1.Settings = "19200,N,8,1"                      ' at 19200 b/s
  MSComm1.RThreshold = 0                                ' poll only, no interrupts
  MSComm1.InputLen = 0                                  ' read all bytes
  MSComm1.PortOpen = True                               ' open COM port
  Label1.Caption = " Select Node ID:  "                 ' update display
  MSComm1.Output = MST$                                 ' master beacon command
  Timer1.Enabled = True                                 ' enable timer
  Exit Sub
Skip:
  Label1.Caption = " Invalid COM  "                     ' update display
End Sub

Public Sub ResetCOM()
  mnuCOM1.Checked = False                               ' clear checkmark
  mnuCOM2.Checked = False                               ' clear checkmark
  mnuCOM3.Checked = False                               ' clear checkmark
  mnuCOM4.Checked = False                               ' clear checkmark
  mnuCOM5.Checked = False                               ' clear checkmark
  mnuCOM6.Checked = False                               ' clear checkmark
  mnuCOM7.Checked = False                               ' clear checkmark
  mnuCOM8.Checked = False                               ' clear checkmark
End Sub

Private Sub mnuC_Click()
  mnuC.Checked = True                                   ' check deg C
  mnuF.Checked = False                                  ' uncheck deg F
  T = 1                                                 ' show deg C
End Sub

Private Sub mnuF_Click()
  mnuC.Checked = False                                  ' uncheck deg C
  mnuF.Checked = True                                   ' check deg F
  T = 0                                                 ' show deg F
End Sub
```

```
Private Sub Text1_Change()
  Dim N As Long                                    ' nibble
  If (Len(Text1.Text) > 0) Then                    ' if new input
    N = Asc(UCase$(Text1.Text))                    '   get first character
  End If
  If (48 <= N) And (N <= 57) Then                  ' convert 0 to 9 ASCII
    A0 = N - 48                                    '   to number
ElseIf (65 <= N) And (N <= 70) Then                ' convert A to F ASCII
    A0 = N - 55                                    '   to number
  Else                                             ' else
    A0 = 0                                         '  default number
  End If
  Call NodeID                                      ' calculate node address
End Sub

Private Sub Text2_Change()
  Dim N As Long                                    ' nibble
  If (Len(Text2.Text) > 0) Then                    ' if new input
    N = Asc(UCase$(Text2.Text))                    '   get first character
  End If
  If (48 <= N) And (N <= 57) Then                  ' convert 0 to 9 ASCII
    A1 = N - 48                                    '   to number
  ElseIf (65 <= N) And (N <= 70) Then              ' convert A to F ASCII
    A1 = N - 55                                    '   to number
  Else                                             ' else
    A1 = 0                                         '  default number
  End If
  Call NodeID                                      ' calculate node address
End Sub

Private Sub Text3_Change()
  Dim N As Long                                    ' nibble
  If (Len(Text3.Text) > 0) Then                    ' if new input
    N = Asc(UCase$(Text3.Text))                    '   get first character
  End If
  If (48 <= N) And (N <= 57) Then                  ' convert 0 to 9 ASCII
    A2 = N - 48                                    '   to number
  ElseIf (65 <= N) And (N <= 70) Then              ' convert A to F ASCII
    A2 = N - 55                                    '   to number
  Else                                             ' else
    A2 = 0                                         '   default number
  End If
  Call NodeID                                      ' calculate node address
End Sub

Private Sub Text4_Change()
  Dim N As Long                                    ' nibble
  If (Len(Text4.Text) > 0) Then                    ' if new input
    N = Asc(UCase$(Text4.Text))                    '   get first character
  End If
  If (48 <= N) And (N <= 57) Then                  ' convert 0 to 9 ASCII
    A3 = N - 48                                    '   to number
  ElseIf (65 <= N) And (N <= 70) Then              ' convert A to F ASCII
    A3 = N - 55                                    '   to number
  Else                                             ' else
    A3 = 0                                         '   default number
  End If
  Call NodeID                                      ' calculate node address
End Sub

Public Sub NodeID()
  ID = 0                                           ' reset ID
  ID = ID + (A0 * 4096)                            ' add nibble to total
  ID = ID + (A1 * 256)                             ' add nibble to total
  ID = ID + (A2 * 16)                              ' add nibble to total
  ID = ID + (A3)                                   ' add nibble to total
  HT = ID \ 256                                    ' HT is integer quotient
  LT = ID - (256 * HT)                             ' LT is remainder
  Label1.Caption = " Temperature:  "               ' update display
End Sub
```

```
Private Sub mnuSleep_Click()
  S = 1                                                 ' run sleep cycle set up
End Sub

Public Sub LoadMsg()

  FND$ = Chr$(&H0) + Chr$(&H7) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H25) + Chr$(&H0) + Chr$(&H1E) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H4)                   ' field node sleep cycle disable

  FNS$ = Chr$(&H0) + Chr$(&H9) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H25) + Chr$(&H0) + Chr$(&H1F) _
  + Chr$(&H3C) + Chr$(&H0) + Chr$(&H0) + Chr$(&H0) _
  + Chr$(&H4)                                           ' field node 60 s sleep period

  FNE$ = Chr$(&H0) + Chr$(&H7) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H25) + Chr$(&H0) + Chr$(&H1E) _
  + Chr$(&H1) + Chr$(&H0) + Chr$(&H4)                   ' field node sleep cycle enable

  MND$ = Chr$(&H0) + Chr$(&H7) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H1) + Chr$(&H1E) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H4)                   ' master node sleep cycle disable

  MNS$ = Chr$(&H0) + Chr$(&H7) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H1) + Chr$(&H20) _
  + Chr$(&HF) + Chr$(&H0) + Chr$(&H4)                   ' master node 15 s sync period

  MNR$ = Chr$(&H0) + Chr$(&H9) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H1) + Chr$(&H21) _
  + Chr$(&H3C) + Chr$(&H0) + Chr$(&H0) + Chr$(&H0) _
  + Chr$(&H4)                                           ' master node 60 s rest period

  MNE$ = Chr$(&H0) + Chr$(&H7) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H1) + Chr$(&H1E) _
  + Chr$(&H2) + Chr$(&H0) + Chr$(&H4)                   ' master node sleep cycle enable

  MNB$ = Chr$(&H0) + Chr$(&H6) + Chr$(&H2) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H1) + Chr$(&H9) _
  + Chr$(&H7) + Chr$(&H4)                               ' master node 7 s beacon interval
command

  MST$ = Chr$(&H0) + Chr$(&H4) + Chr$(&H3) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H0) + Chr$(&H4)       ' turn on master beacon

  MSG$ = Chr$(&H0) + Chr$(&H8) + Chr$(&HB) _
  + Chr$(&H0) + Chr$(&H25) + Chr$(&H0) + Chr$(&H2) _
  + Chr$(&H26) + Chr$(&HA) + Chr$(&H0) + Chr$(&H4)      ' read ADC on GP6

  MNC$ = Chr$(&H0) + Chr$(&H5) + Chr$(&H1) _
  + Chr$(&H0) + Chr$(&H0) + Chr$(&H1) + Chr$(&H22) _
  + Chr$(&H4)                                           ' read master sleep cycle

End Sub

Private Sub Form_Unload(Cancel As Integer)
  If (MSComm1.PortOpen = True) Then                     ' if COM port open
    MSComm1.PortOpen = False                            '   close it
  End If
  End                                                   ' done
End Sub
```

Updated 2007.07.25